



Technical Service BULLETIN

April 28, 2000

Title:

SQUEAK NOISE FROM FRONT OF VEHICLE

Models:

'00 MR2 Spyder

NAV
00-8008-00

Introduction Shorter front license plate bracket mounting bolts have been adopted to prevent the possibility of a squeak noise from the front of the vehicle.

Applicable Vehicles

- 2000 model year MR2 Spyder

Production Change Information


MODEL	STARTING VIN
2000 MR2 Spyder	JTDFR320*Y0005168

Parts Information

PREVIOUS PART NUMBER	CURRENT PART NUMBER	PART NAME	QUANTITY
90159-60215	90159-60444	Bolt	3

Repair Procedure

Replace the front license plate bracket mounting bolts with P/N 90159-60444 or equivalent (M6 x 2.5 x 20 mm).

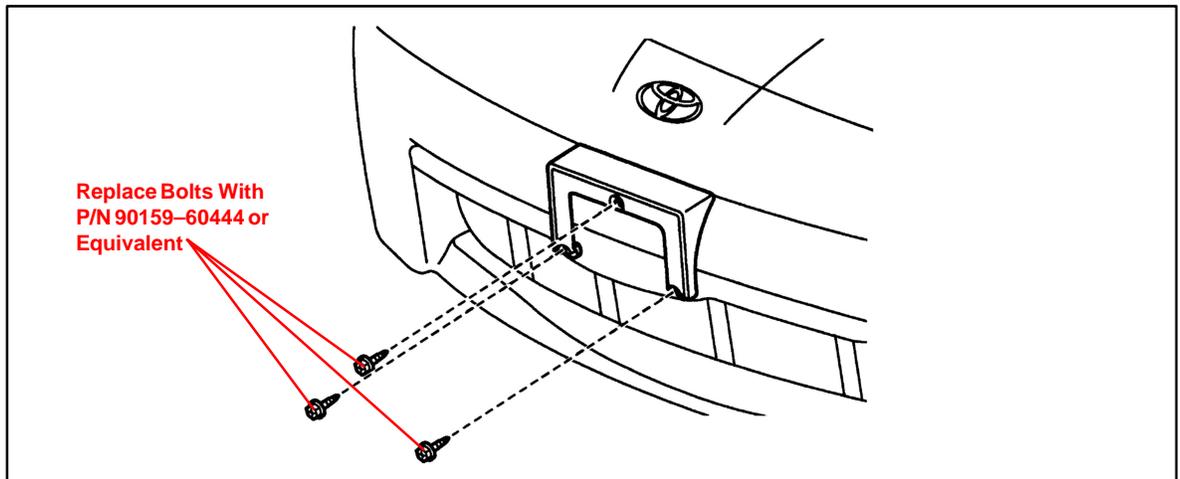

Warranty Information

OP CODE	DESCRIPTION	TIME	OPN	T1	T2
BD0010	R & R Front License Plate Bracket Bolts	0.2	90159-60215	91	44

Applicable Warranty*:

This repair is covered under the Toyota Basic Warranty. This warranty is in effect for 36 months or 36,000 miles, whichever occurs first, from the vehicle's in-service date.

* Warranty application is limited to correction of a problem based upon a customer's specific complaint.

