



**Technical Service
BULLETIN**

September 7, 2001

Title:

ENGINE HOOD RELEASE OPERATION

Models:

'00 – '01 MR2 Spyder

BODY
BO021-01

Introduction A new hood lock assembly with two new springs has been developed to improve inoperative and difficult-to-open conditions.

- Applicable Vehicles**
- **2000 – 2001** model year **MR2 Spyder** vehicles.

Production Change Information

MODEL	STARTING VIN
2001 MR2 Spyder	JTDFR3206Y0030611


Parts Information

PREVIOUS PART NUMBER	CURRENT PART NUMBER	PART NAME
69350-17050	69350-17051	Lock Assy, Engine Hood

Repair Procedure

After installation of the new part, refer to the MR2 Repair Manual for adjustment instructions:

- 2000 MR2 Repair Manual (Pub. No. RM760U) pages BO-9 and BO-10.
- 2001 MR2 Repair Manual (Pub. No. RM801U) page BO-10.

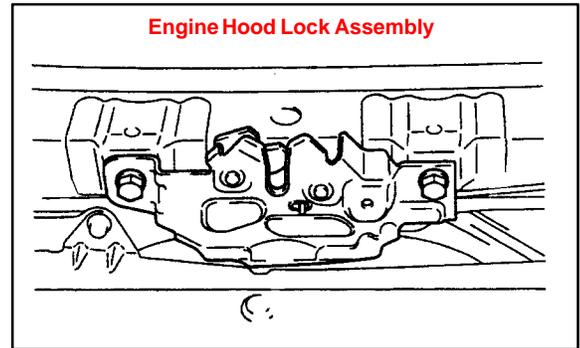

Warranty Information

OP CODE	DESCRIPTION	TIME	OPN	T1	T2
BD1025	R & R Lock Assy, Engine Hood	0.2	69350-17050	52	83

Applicable Warranty*:

This repair is covered under the Toyota Basic Warranty. This warranty is in effect for 36 months or 36,000 miles, whichever occurs first, from the vehicle's in-service date.

* Warranty application is limited to correction of a problem based upon a customer's specific complaint.

